

HILTI

AG 125-7SE

AG 125-8SE


English

1

עברית

14



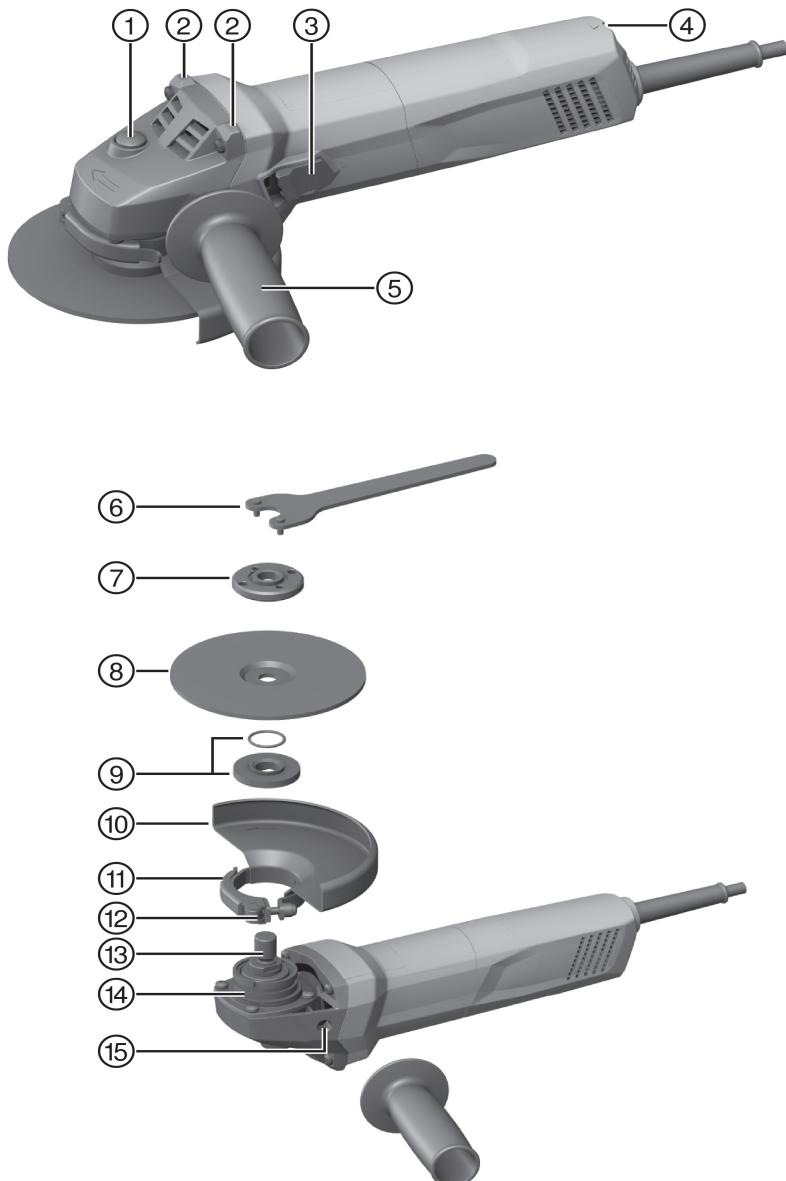

2




3




4










5

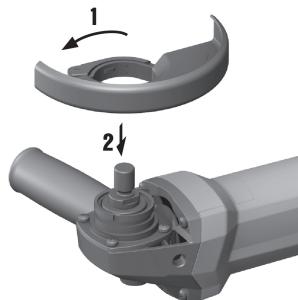


3


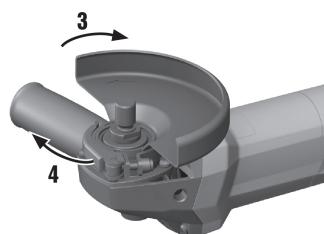


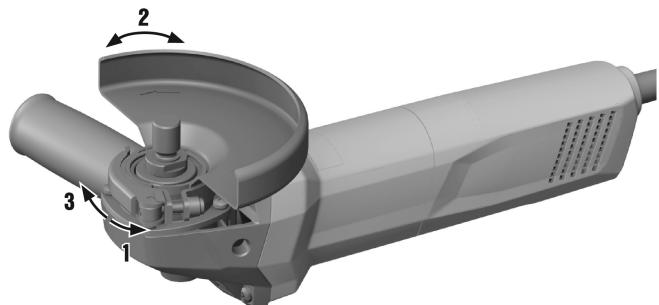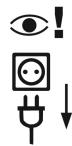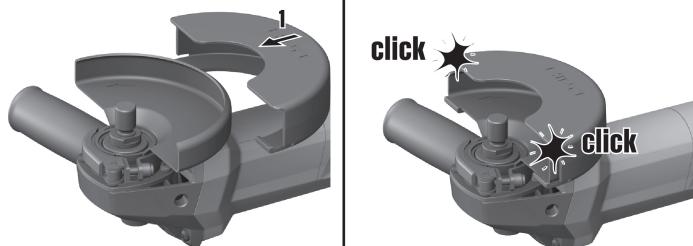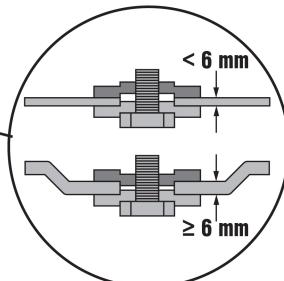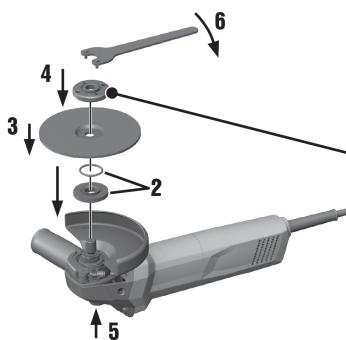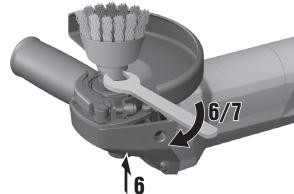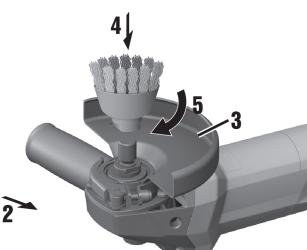6**7****8****9**



10

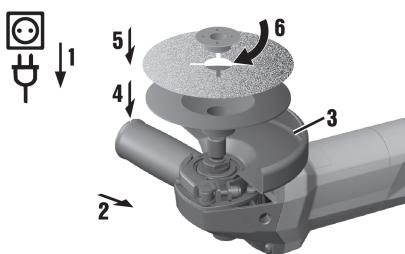





11

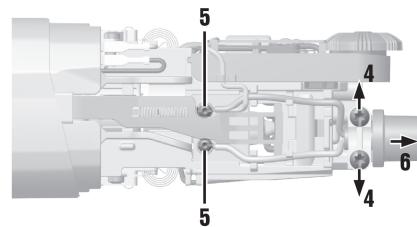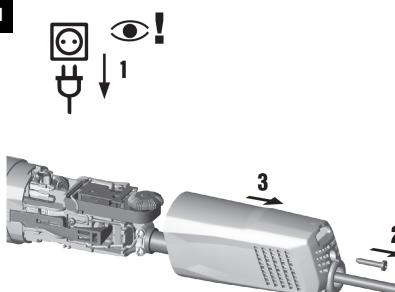


12

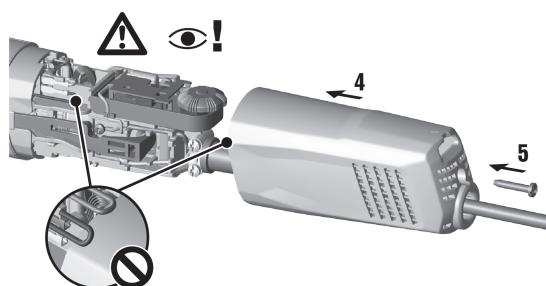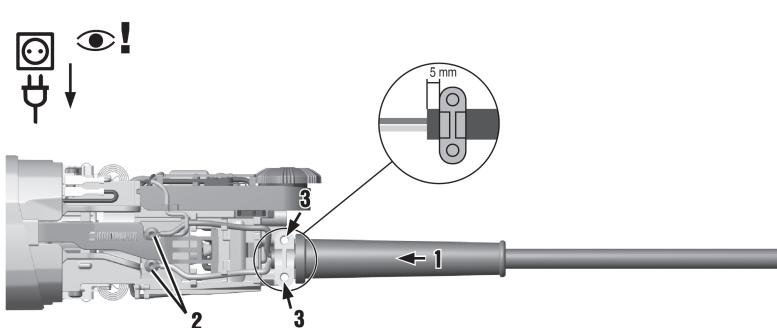









13

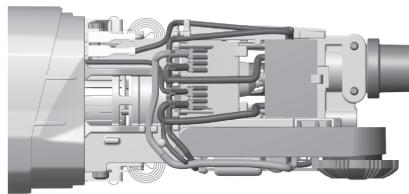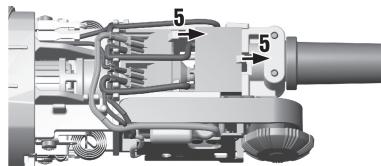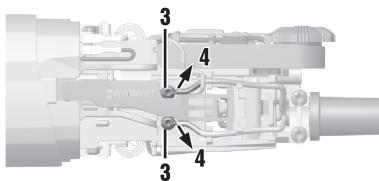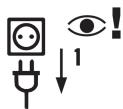

14

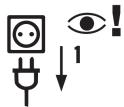

2x

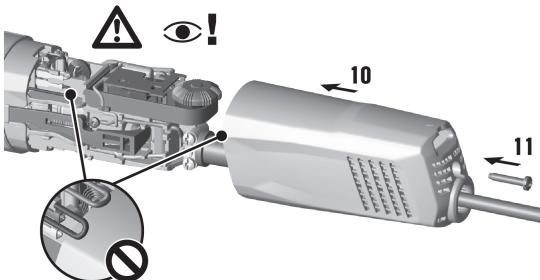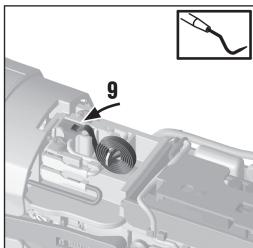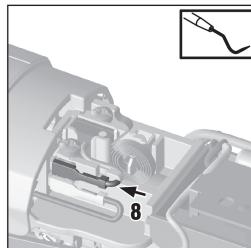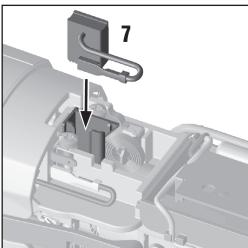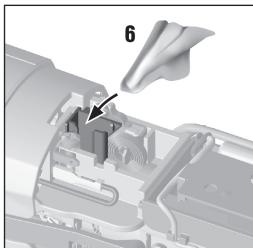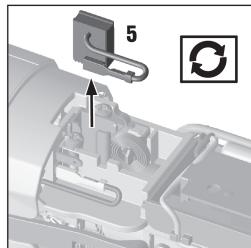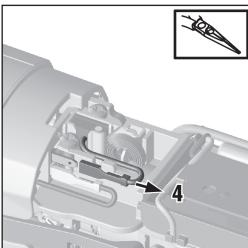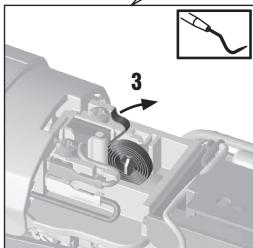

AG 125-7SE

AG 125-8SE

en	Original operating instructions	1
he	הוראות הפעלה מקוריות	14

1 Information about the documentation

1.1 About this documentation

- Read this documentation before initial operation or use. This is a prerequisite for safe, trouble-free handling and use of the product.
- Observe the safety instructions and warnings in this documentation and on the product.
- Always keep the operating instructions with the product and make sure that the operating instructions are with the product when it is given to other persons.

1.2 Explanation of symbols used

1.2.1 Warnings

Warnings alert persons to hazards that may occur when handling or using the product. The following signal words are used in combination with a symbol:

	DANGER! Draws attention to an imminent hazard that will lead to serious personal injury or fatality.
	WARNING! Draws attention to a potential hazard that could lead to serious personal injury or fatality.
	CAUTION! Draws attention to a potentially dangerous situation that could lead to minor personal injury or material damage.

1.2.2 Symbols in the documentation

The following symbols are used in this document:

	Read the operating instructions before use
	Instructions for use and other useful information

1.2.3 Symbols in the illustrations

The following symbols are used in illustrations:

	These numbers refer to the corresponding illustrations found at the beginning of these operating instructions.
3	The numbering reflects the sequence of operations shown in the illustrations and may deviate from the steps described in the text.
	Item reference numbers are used in the overview illustration and refer to the numbers used in the key in the product overview section.
	This symbol is intended to draw special attention to certain points when handling the product.

1.3 Product-dependent symbols

1.3.1 Symbols on the product

The following symbols are used on the product:

	Wear eye protection.
/min	Revolutions per minute
RPM	Revolutions per minute
n	Rated speed
	Diameter
	Protection class II (double-insulated)

1.4 Product information

Hilti products are designed for professional use and may be operated, serviced and maintained only by trained, authorized personnel. This personnel must be informed of any particular hazards that may be encountered. The product and its ancillary equipment may present hazards when used incorrectly by untrained personnel or when used not as directed.

The type designation and serial number are printed on the rating plate.

- ▶ Write down the serial number in the table below. You will be required to state the product details when contacting Hilti Service or your local Hilti organization to enquire about the product.

Product information

Angle grinder	AG 125-8SE AG 125-7SE
Generation	05
Serial no.	

1.5 Declaration of conformity

We declare, on our sole responsibility, that the product described here complies with the applicable directives and standards. A copy of the declaration of conformity can be found at the end of this documentation.

The technical documentation is filed and stored here:

Hilti Entwicklungsgesellschaft mbH | Tool Certification | Hiltistrasse 6 | 86916 Kaufering, Germany

2 Safety

2.1 General power tool safety warnings

⚠ WARNING

Read all safety warnings and all instructions. Failure to follow the warnings and instructions may result in electric shock, fire and/or serious injury.

Save all warnings and instructions for future reference.

The term "power tool" in the warnings refers to your mains-operated (corded) power tool or battery-operated (cordless) power tool.

Work area safety

- ▶ **Keep work area clean and well lit.** Cluttered or dark areas invite accidents.
- ▶ **Do not operate power tools in explosive atmospheres, such as in the presence of flammable liquids, gases or dust.** Power tools create sparks which may ignite the dust or fumes.
- ▶ **Keep children and bystanders away while operating a power tool.** Distractions can cause you to lose control.

Electrical safety

- ▶ **Power tool plugs must match the outlet. Never modify the plug in any way. Do not use any adapter plugs with earthed (grounded) power tools.** Unmodified plugs and matching outlets will reduce risk of electric shock.
- ▶ **Avoid body contact with earthed or grounded surfaces, such as pipes, radiators, ranges and refrigerators.** There is an increased risk of electric shock if your body is earthed or grounded.
- ▶ **Do not expose power tools to rain or wet conditions.** Water entering a power tool will increase the risk of electric shock.
- ▶ **Do not abuse the cord.** Never use the cord for carrying, pulling or unplugging the power tool. **Keep cord away from heat, oil, sharp edges or moving parts.** Damaged or entangled cords increase the risk of electric shock.
- ▶ **When operating a power tool outdoors, use an extension cord suitable for outdoor use.** Use of a cord suitable for outdoor use reduces the risk of electric shock.
- ▶ **If operating a power tool in a damp location is unavoidable, use a residual current device (RCD) protected supply.** Use of an RCD reduces the risk of electric shock.

Personal safety

- ▶ **Stay alert, watch what you are doing and use common sense when operating a power tool. Do not use a power tool while you are tired or under the influence of drugs, alcohol or medication.** A moment of inattention while operating power tools may result in serious personal injury.
- ▶ **Use personal protective equipment. Always wear eye protection.** Protective equipment such as dust mask, non-skid safety shoes, hard hat, or hearing protection used for appropriate conditions will reduce personal injuries.

- ▶ Prevent unintentional starting. Ensure the switch is in the off-position before connecting to power source and/or battery pack, picking up or carrying the tool. Carrying power tools with your finger on the switch or energising power tools that have the switch on invites accidents.
- ▶ Remove any adjusting key or wrench before turning the power tool on. A wrench or a key left attached to a rotating part of the power tool may result in personal injury.
- ▶ Do not overreach. Keep proper footing and balance at all times. This enables better control of the power tool in unexpected situations.
- ▶ Dress properly. Do not wear loose clothing or jewellery. Keep your hair, clothing and gloves away from moving parts. Loose clothes, jewellery or long hair can be caught in moving parts.
- ▶ If devices are provided for the connection of dust extraction and collection facilities, ensure these are connected and properly used. Use of dust collection can reduce dust-related hazards.

Power tool use and care

- ▶ Do not force the power tool. Use the correct power tool for your application. The correct power tool will do the job better and safer at the rate for which it was designed.
- ▶ Do not use the power tool if the switch does not turn it on and off. Any power tool that cannot be controlled with the switch is dangerous and must be repaired.
- ▶ Disconnect the plug from the power source and/or the battery pack from the power tool before making any adjustments, changing accessories, or storing power tools. Such preventive safety measures reduce the risk of starting the power tool accidentally.
- ▶ Store idle power tools out of the reach of children and do not allow persons unfamiliar with the power tool or these instructions to operate the power tool. Power tools are dangerous in the hands of untrained users.
- ▶ Maintain power tools. Check for misalignment or binding of moving parts, breakage of parts and any other condition that may affect the power tool's operation. If damaged, have the power tool repaired before use. Many accidents are caused by poorly maintained power tools.
- ▶ Keep cutting tools sharp and clean. Properly maintained cutting tools with sharp cutting edges are less likely to bind and are easier to control.
- ▶ Use the power tool, accessories and tool bits etc. in accordance with these instructions, taking into account the working conditions and the work to be performed. Use of the power tool for operations different from those intended could result in a hazardous situation.

Service

- ▶ Have your power tool serviced by a qualified repair person using only identical replacement parts. This will ensure that the safety of the power tool is maintained.

2.2 Safety warnings common for grinding, sanding, wire brushing, polishing or abrasive cutting-off operations:

- ▶ This power tool is intended to function as a grinder, sander, wire brush or cut-off tool. Read all safety warnings, instructions, illustrations and specifications provided with this power tool. Failure to follow all instructions listed below may result in electric shock, fire and/or serious injury.
- ▶ Operations such as polishing are not recommended to be performed with this power tool. Operations for which the power tool was not designed may create a hazard and cause personal injury.
- ▶ Do not use accessories which are not specifically designed and recommended by the tool manufacturer. Just because the accessory can be attached to your power tool, it does not assure safe operation.
- ▶ The rated speed of the accessory must be at least equal to the maximum speed marked on the power tool. Accessories running faster than their rated speed can break and fly apart.
- ▶ The outside diameter and the thickness of your accessory must be within the capacity rating of your power tool. Incorrectly sized accessories cannot be adequately guarded or controlled.
- ▶ Threaded mounting of accessories must match the grinder spindle thread. For accessories mounted by flanges, the arbour hole of the accessory must fit the locating diameter of the flange. Accessories that do not match the mounting hardware of the power tool will run out of balance, vibrate excessively and may cause loss of control.
- ▶ Do not use a damaged accessory. Before each use inspect the accessory such as abrasive wheels for chips and cracks, backing pad for cracks, tear or excess wear, wire brush for loose or cracked wires. If power tool or accessory is dropped, inspect for damage or install an undamaged accessory. After inspecting and installing an accessory, position yourself and bystanders away from the plane of the rotating accessory and run the power tool at maximum no-load speed for one minute. Damaged accessories will normally break apart during this test time.
- ▶ Wear personal protective equipment. Depending on application, use face shield, safety goggles or safety glasses. As appropriate, wear dust mask, hearing protectors, gloves and workshop apron

- capable of stopping small abrasive or workpiece fragments.** The eye protection must be capable of stopping flying debris generated by various operations. The dust mask or respirator must be capable of filtrating particles generated by your operation. Prolonged exposure to high intensity noise may cause hearing loss.
- ▶ **Keep bystanders a safe distance away from work area. Anyone entering the work area must wear personal protective equipment.** Fragments of workpiece or of a broken accessory may fly away and cause injury beyond immediate area of operation.
 - ▶ **Hold the power tool by insulated gripping surfaces only, when performing an operation where the cutting accessory may contact hidden wiring or its own cord.** Cutting accessory contacting a "live" wire may make exposed metal parts of the power tool "live" and could give the operator an electric shock.
 - ▶ **Position the cord clear of the spinning accessory.** If you lose control, the cord may be cut or snagged and your hand or arm may be pulled into the spinning accessory.
 - ▶ **Never lay the power tool down until the accessory has come to a complete stop.** The spinning accessory may grab the surface and pull the power tool out of your control.
 - ▶ **Do not run the power tool while carrying it at your side.** Accidental contact with the spinning accessory could snag your clothing, pulling the accessory into your body.
 - ▶ **Regularly clean the power tool's air vents.** The motor's fan will draw the dust inside the housing and excessive accumulation of powdered metal may cause electrical hazards.
 - ▶ **Do not operate the power tool near flammable materials.** Sparks could ignite these materials.
 - ▶ **Do not use accessories that require liquid coolants.** Using water or other liquid coolants may result in electrocution or shock.

Kickback and related warnings

Kickback is a sudden reaction to a pinched or snagged rotating wheel, backing pad, brush or any other accessory. Pinching or snagging causes rapid stalling of the rotating accessory which in turn causes the uncontrolled power tool to be forced in the direction opposite of the accessory's rotation at the point of the binding.

For example, if an abrasive wheel is snagged or pinched by the workpiece, the edge of the wheel that is entering into the pinch point can dig into the surface of the material causing the wheel to climb out or kick out. The wheel may either jump toward or away from the operator, depending on direction of the wheel's movement at the point of pinching. Abrasive wheels may also break under these conditions.

Kickback is the result of power tool misuse and/or incorrect operating procedures or conditions and can be avoided by taking proper precautions as given below.

- ▶ **Maintain a firm grip on the power tool and position your body and arm to allow you to resist kickback forces. Always use auxiliary handle, if provided, for maximum control over kickback or torque reaction during start-up.** The operator can control torque reactions or kickback forces, if proper precautions are taken.
- ▶ **Never place your hand near the rotating accessory.** Accessory may kickback over your hand.
- ▶ **Do not position your body in the area where power tool will move if kickback occurs.** Kickback will propel the tool in direction opposite to the wheel's movement at the point of snagging.
- ▶ **Use special care when working corners, sharp edges etc. Avoid bouncing and snagging the accessory.** Corners, sharp edges or bouncing have a tendency to snag the rotating accessory and cause loss of control or kickback.
- ▶ **Do not attach a saw chain woodcarving blade or toothed saw blade.** Such blades create frequent kickback and loss of control.

Safety warnings specific for grinding and abrasive cutting-off operations:

- ▶ **Use only wheel types that are recommended for your power tool and the specific guard designed for the selected wheel.** Wheels for which the power tool was not designed cannot be adequately guarded and are unsafe.
- ▶ **The grinding surface of centre depressed wheels must be mounted below the plane of the guard lip.** An improperly mounted wheel that projects through the plane of the guard lip cannot be adequately protected.
- ▶ **The guard must be securely attached to the power tool and positioned for maximum safety, so the least amount of wheel is exposed towards the operator.** The guard helps to protect the operator from broken wheel fragments, accidental contact with wheel and sparks that could ignite clothing.
- ▶ **Wheels must be used only for recommended applications. For example: do not grind with the side of cut-off wheel.** Abrasive cut-off wheels are intended for peripheral grinding, side forces applied to these wheels may cause them to shatter.

- ▶ **Always use undamaged wheel flanges that are of correct size and shape for your selected wheel.** Proper wheel flanges support the wheel thus reducing the possibility of wheel breakage. Flanges for cut-off wheels may be different from grinding wheel flanges.
- ▶ **Do not use worn down wheels from larger power tools.** Wheel intended for larger power tool is not suitable for the higher speed of a smaller tool and may burst.

Additional safety warnings specific for abrasive cutting-off operations:

- ▶ **Do not "jam" the cut-off wheel or apply excessive pressure. Do not attempt to make an excessive depth of cut.** Overstressing the wheel increases the loading and susceptibility to twisting or binding of the wheel in the cut and the possibility of kickback or wheel breakage.
- ▶ **Do not position your body in line with and behind the rotating wheel.** When the wheel, at the point of operation, is moving away from your body, the possible kickback may propel the spinning wheel and the power tool directly at you.
- ▶ **When wheel is binding or when interrupting a cut for any reason, switch off the power tool and hold the power tool motionless until the wheel comes to a complete stop. Never attempt to remove the cut-off wheel from the cut while the wheel is in motion otherwise kickback may occur.** Investigate and take corrective action to eliminate the cause of wheel binding.
- ▶ **Do not restart the cutting operation in the workpiece. Let the wheel reach full speed and carefully re-enter the cut.** The wheel may bind, walk up or kickback if the power tool is restarted in the workpiece.
- ▶ **Support panels or any oversized workpiece to minimize the risk of wheel pinching and kickback.** Large workpieces tend to sag under their own weight. Supports must be placed under the workpiece near the line of cut and near the edge of the workpiece on both sides of the wheel.
- ▶ **Use extra caution when making a "pocket cut" into existing walls or other blind areas.** The protruding wheel may cut gas or water pipes, electrical wiring or objects that can cause kickback.

Safety warnings specific for sanding operations:

- ▶ **Do not use excessively oversized sanding disc paper. Follow manufacturers recommendations, when selecting sanding paper.** Larger sanding paper extending beyond the sanding pad presents a laceration hazard and may cause snagging, tearing of the disc or kickback.

Safety warnings specific for wire brushing operations:

- ▶ **Be aware that wire bristles are thrown by the brush even during ordinary operation. Do not overstress the wires by applying excessive load to the brush.** The wire bristles can easily penetrate light clothing and/or skin.
- ▶ **If the use of a guard is recommended for wire brushing, do not allow any interference of the wire wheel or brush with the guard.** Wire wheel or brush may expand in diameter due to work load and centrifugal forces.

Safety warnings specific for polishing operations:

- ▶ **Do not allow any loose portion of the polishing bonnet or its attachment strings to spin freely. Tuck away or trim any loose attachment strings.** Loose and spinning attachment strings can entangle your fingers or snag on the workpiece.

2.3 Additional safety instructions

Personal safety

- ▶ Only use the product if it is in perfect working order.
- ▶ Never tamper with or modify the tool in any way.
- ▶ Avoid touching rotating parts – risk of injury!
- ▶ Wear protective gloves also when changing the accessory tool. Touching the accessory tool presents a risk of injury (cuts or burns).
- ▶ Before starting work, check the hazard class of the dust that will be produced when working. Use an industrial vacuum cleaner with an officially approved protection class in compliance with the locally applicable dust protection regulations. Dust from materials such as lead-based paint, certain types of wood and concrete/masonry/stone containing quartz, minerals or metal may be harmful to health.
- ▶ Make sure that the workplace is well ventilated and, where necessary, wear a respirator appropriate for the type of dust generated. Contact with or inhalation of the dust may cause allergic reactions and/or respiratory or other diseases among operators or bystanders. Certain kinds of dust are classified as carcinogenic such as oak and beech dust, especially in conjunction with additives for wood conditioning (chromate, wood preservative). Material containing asbestos may be handled only by specialists.
- ▶ Take breaks between working and do physical exercises to improve the blood circulation in your fingers. Exposure to vibration during long periods of work can lead to disorders of the blood vessels and nervous system in the fingers, hands and wrists.

Electrical safety

- Before beginning work, check the working area for concealed electric cables or gas and water pipes. External metal parts of the power tool may give you an electric shock if you damage an electric cable accidentally.

Using and handling power tools with care

- Do not use cutting discs for grinding.
- Tighten the accessory tool and flange securely. If the accessory tool and flange are not tightened securely, the accessory tool may work loose from the spindle due to the braking effect of the motor after switching off.
- Comply with the manufacturer's instructions for handling and storing grinding discs.

3 Description

3.1 Product overview 1

(1)	Arbor lockbutton	(9)	Clamping flange with O-ring
(2)	Steadying rib for set-down	(10)	Guard
(3)	On/off switch	(11)	Clamping lever
(4)	Speed adjustment thumbwheel	(12)	Adjusting screw
(5)	Side handle	(13)	Arbor
(6)	Pin wrench	(14)	Keyed locating lug
(7)	Clamping nut	(15)	Threaded socket for side handle
(8)	Abrasive cutting disc/abrasive grinding disc		

3.2 Intended use

The product described is a hand-held electric angle grinder. It is designed for cutting, grinding and sanding metal and mineral materials without use of water.

The tool may be operated only when connected to a power supply providing a voltage and frequency in compliance with the information given on its rating plate.

- The power tool may be used for cutting, slitting and grinding mineral materials only when equipped with the corresponding guard and front cover.
- A dust removal hood together with a suitable **Hilti** vacuum cleaner must be used for working on mineral materials such as concrete or stone.

3.3 Items supplied

Angle grinder, side handle, standard guard, front cover, clamping flange, clamping nut, wrench, operating instructions.

Other system products approved for use with this product can be found at your local **Hilti Store** or online at: www.hilti.group | USA: www.hilti.com

3.4 Speed preselection

This angle grinder has adjustable speed preselection with 6 speeds:

- AG 125 7SE: 6000 - 11500 rpm
- AG 125 8SE: 3500 - 11500 rpm

3.5 Restart interlock

The power tool does not restart by itself when the on/off switch is locked in the on-position and the power returns after an interruption in the electric supply. The on/off switch must first be released and then pressed again to restart.

3.6 Front cover for the disc guard 2

When grinding with straight grinding discs and cutting with cutting discs in metalworking applications, use the standard guard with front cover.

3.7 DG-EX 115/4,5" dust hood for grinding (accessory) 3

The grinding system is suitable only for occasional use with diamond cup wheels for grinding mineral materials.

CAUTION Use of this hood for working on metal is prohibited.

3.8 DC-EX 125/5°C dust hood for cutting (accessory) 4

Use the DC-EX 125/5°C dust hood when cutting masonry and concrete.

CAUTION Use of this hood for working on metal is prohibited.

4 Consumables

Only synthetic resin-bonded, fiber-reinforced discs with a maximum diameter of Ø 125 mm which are approved for use at a rotational speed of at least 11,500/min and a peripheral speed of 80 m/s may be used. The maximum grinding disc thickness is 6.4 mm and the maximum cutting disc thickness is 2.5 mm.

WARNING! When cutting or slitting with cutting discs, always use the standard guard with additional cover plate.

Discs

	Application	Designation	Material
Abrasive cutting disc	Cutting, slitting	AC-D	Metal
Diamond cutting disc	Cutting, slitting	DC-TP, DC-D (SPX, SP, P)	Mineral
Abrasive grinding disc	Rough grinding	AG-D, AF-D, AN-D	Metal
Diamond grinding disc	Rough grinding	DG-CW (SPX, SP, P)	Mineral
Wire brushes	Wire brushes	3CS, 4CS, 3SS, 4SS	Metal
Abrasive resin-fiber disc	Rough grinding	AP-D	Metal

Suitability of discs for the equipment used

Item	Equipment	AC-D	AG-D, AF-D, AN-D	DG-CW (SPX, SP, P)	DC-TP, DC-D (SPX, SP, P)	AP-D	3CS, 4CS, 3SS, 4SS
A	Guard	X	X	X	X	X	X
B	Front cover (in combination with A)	X	—	—	X	—	—
C	DG-EX 115/4.5" dust hood for grinding (only for 115 DG-CW)	—	—	X	—	—	—
D	DC-EX 125/5°C dust hood for cutting (only in conjunction with A)	—	—	—	X	—	—
E	Side handle	X	X	X	X	X	X
F	Clamping nut	X	X	X	X	—	—
G	Clamping flange	X	X	X	X	—	—
H	Clamping nut for abrasive resin-fiber disc	—	—	—	—	X	—
I	Support plate	—	—	—	—	X	—

5 Technical data

5.1 Angle grinder



Note

For rated voltage, frequency, current and input power, please refer to the country-specific type identification plate.

If the device is powered by a generator or transformer, the generator or transformer's power output must be at least twice the rated input power shown on the type identification plate of the device. The operating voltage of the transformer or generator must always be within +5% and -15% of the rated voltage of the device.

	AG 125-7SE	AG 125-8SE
Rated power input	710 W	800 W
Rated speed	11,500 /min	11,500 /min
Maximum disc diameter	125 mm	125 mm
Thread diameter	M14	M14
Thread length	22 mm	22 mm
Weight in accordance with EPTA procedure 01	2.0 kg	2.0 kg

5.2 Noise information and vibration values in accordance with EN 60745

The sound pressure and vibration values given in these instructions have been measured in accordance with a standardized test and may be used to compare one power tool with another. They may be used for a preliminary assessment of exposure.

The data given represents the main applications of the power tool. However, if the power tool is used for different applications, with different accessory tools or is poorly maintained, the data may vary. This may significantly increase exposure over the total working period.

An accurate estimation of exposure should also take into account the times when the power tool is switched off, or when it is running but not actually being used for a job. This may significantly reduce exposure over the total working period.

Identify additional safety measures to protect the operator from the effects of noise and/or vibration, for example: Maintaining the power tool and accessory tools, keeping the hands warm, organization of work patterns.

Noise emission values

	AG 125-7SE	AG 125-8SE
Sound power level (L_{WA})	96.3 dB(A)	96.3 dB(A)
Uncertainty for the sound power level (K_{WA})	3 dB(A)	3 dB(A)
Emission sound pressure level (L_{pA})	85.3 dB(A)	85.3 dB(A)
Uncertainty for the sound pressure level (K_{pA})	3 dB(A)	3 dB(A)

Total vibration

	AG 125-7SE	AG 125-8SE
Surface grinding with the vibration-absorbing side handle ($a_{h,AG}$)	4.8 m/s ²	4.8 m/s ²
Sanding ($a_{h,DS}$)	3.6 m/s ²	3.6 m/s ²
Uncertainty (K)	1.5 m/s ²	1.5 m/s ²

6 Operation

6.1 Preparations at the workplace



CAUTION

Risk of injury! Inadvertent starting of the product.

- ▶ Unplug the supply cord before making adjustments to the power tool or before changing accessories.

Observe the safety instructions and warnings in this documentation and on the product.

6.2 Fitting the side handle

- ▶ Screw the side handle into one of the threaded bushings provided.

6.3 Guard

- ▶ Observe the instructions for fitting the applicable guard.

6.3.1 Fitting the guard 5



Note

The keying on the guard ensures that only a guard designed for use with the power tool can be fitted. The keyed locating lug also prevents the guard from coming into contact with the disc.

1. Release the clamping lever.
2. Fit the guard onto the spindle collar so that the keyed locating lug engages in the recess provided.
3. Rotate the guard to the required position.
4. Secure the guard by closing the clamping lever.



Note

The guard is already set to the correct tension by way of the adjusting screw. If the tension is too low when the guard is fitted, the adjusting screw can be tightened slightly to increase the tension.

6.3.2 Adjusting the guard 6

1. Release the clamping lever.
2. Turn the guard to the required position.
3. Secure the guard by closing the clamping lever.

6.3.3 Removing the guard

1. Release the clamping lever.
2. Rotate the guard until the keyed locating lug is aligned with the keyed locating groove and then remove the guard.

6.4 Fitting or removing the front cover 7

1. Position the front cover with the closed side on the standard guard and push it on until it engages.
2. To remove it, release the catch for the front cover and then lift the front cover away from the standard guard.

6.5 Fitting or removing the discs



CAUTION

Risk of injury. The accessory tool may be hot.

- ▶ Wear protective gloves when changing the accessory tool.



Note

Diamond discs must be replaced when their cutting or grinding performance drops significantly. This generally is the case when the diamond segments reach a height of less than 2 mm (1/16").

Other discs must be replaced when their cutting performance drops significantly or other parts of the angle grinder (not the disc) come into contact with the material you are working on.

Abrasives discs must be replaced when their expiry date has been reached.

6.5.1 Fitting the grinding disc 8

1. Disconnect the mains plug from the power outlet.
2. Check that the O-ring is in place in the clamping flange and that it is undamaged.

Result

The O-ring is damaged.

There is no O-ring in the clamping flange.

- ▶ Fit a new clamping flange with O-ring.

3. Fit the clamping flange onto the drive spindle.
4. Fit the grinding disc.
5. Screw on the clamping nut corresponding to the type of accessory tool fitted.

6. Press the spindle lockbutton and hold it in this position.
7. Use the pin wrench to tighten the clamping nut securely, then release the spindle lockbutton and remove the wrench.

6.5.2 Removing the grinding disc

1. Disconnect the mains plug from the power outlet.



CAUTION

Risk of breakage and irreparable damage. If the spindle lockbutton is pressed while the spindle is rotating, this may cause the accessory tool to work loose or detach from the power tool.

- ▶ Press the spindle lockbutton only when the spindle has stopped rotating.

2. Press the spindle lockbutton and hold it in this position.
3. Release the clamping nut by gripping it with the pin wrench and turning the nut counterclockwise.
4. Release the spindle lockbutton and remove the grinding disc.

6.6 Fitting the wire brush 9

1. Disconnect the mains plug from the power outlet.
2. Fit the side handle. → page 8
3. Fit the guard. → page 9
4. Place the wire brush in position and tighten it hand-tight.
5. Press the spindle lockbutton and hold it in this position.
6. Tighten the wire brush with a suitable open-end wrench.
7. Then release the spindle lockbutton and remove the open-end wrench.

6.7 Fitting the abrasive resin-fiber disc 10

1. Disconnect the mains plug from the power outlet.
2. Fit the side handle. → page 8
3. Fit the guard. → page 9
4. Fit the support plate and the abrasive resin-fiber disc, screw on the clamping nut and tighten it securely.
5. Press the spindle lockbutton and hold it in this position.
6. Use the pin wrench to tighten the clamping nut securely, then release the spindle lockbutton and remove the wrench.

6.8 Types of work



WARNING

Damaged power cords are a safety hazard! If the supply cord or extension cord is damaged while work is in progress, immediately disconnect the device and the cord from the electricity supply. Do not touch the damaged part of the cord.

- ▶ Regularly check all supply cords. Replace defective extension cords. Have damaged power cords replaced by a qualified specialist.

Use of a ground fault circuit interrupter (residual current device, RCD) with a maximum tripping current of 30 mA is recommended.

6.9 Switching on

1. Plug the supply cord into the power outlet.
2. Press the rear section of the on/off switch.
3. Slide the on/off switch forward.
4. Lock the on/off switch.
 - The motor runs.

6.10 Cutting

- ▶ When cutting, apply moderate feed pressure and do not tilt the power tool or the cutting disc (when working, hold at approx. 90° to the surface being cut).



Note

For best results when cutting profiles and square tube, start cutting at the smallest cross section.

6.11 Rough grinding



CAUTION

Risk of injury. The abrasive cutting disc could shatter and flying fragments may cause injury.

- ▶ Never use abrasive cutting discs for grinding.

- ▶ Move the power tool to and fro while maintaining a 5° to 30° angle of attack and applying moderate pressure.

▫ This will avoid overheating and discoloration of the workpiece and help ensure an even surface finish.

6.12 Switching off

- ▶ Press the rear section of the on/off switch.

▫ The on/off switch jumps into the off position and the motor stops.

7 Care and maintenance

7.1 Care and maintenance



WARNING

Danger of electric shock! Carrying out care and maintenance while the supply cord is connected to the power outlet presents a risk of serious injuries including burns.

- ▶ Always unplug the supply cord before carrying out all care and maintenance tasks.

Care

- Carefully remove stubborn dirt.
- Clean the air vents carefully with a dry brush.
- Use only a slightly damp cloth to clean the casing. Do not use cleaning agents containing silicone as they can attack the plastic parts.

Maintenance

- At regular intervals, check all visible parts and the controls for signs of damage and make sure that they all function correctly.
- Do not operate the power tool if signs of damage are found or if parts malfunction. Have damage repaired immediately by **Hilti** Service.
- After cleaning and maintenance, refit all guards or protective devices and check that they function correctly.



Note

To help ensure safe and reliable operation, use only genuine Hilti spare parts and consumables. Spare parts, consumables and accessories approved by Hilti for use with the product can be found at your local **Hilti Store** or online at: www.hilti.group / www.hilti.com

7.2 Replacing the supply cord

7.2.1 Removing the supply cord

1. Disconnect the supply cord plug from the power outlet.
2. Unscrew the screw in the rear part of the housing and remove the rear part of the housing.
3. Slacken the two strain relief clamp screws.
4. Unscrew the two screws and disconnect and remove the supply cord.

7.2.2 Fitting the supply cord 12

1. Work the supply cord into position in the rear part of the housing.
2. Push the supply cord through the protective sleeve.
3. Strip 5 mm of insulation off the ends of the conductors.
4. Insert both conductors under the strain relief clamp.
5. Slip the supply cord conductors underneath the two screws and tighten the screws (tightening torque: 0.5-0.8 Nm).
6. Position the supply cord so that the protective sleeve fits snugly, without a gap.
7. Make sure that the cable sheath projects 5 mm past the strain relief clamp and tighten the screws of the strain relief clamp (tightening torque: 1.35-1.75 Nm).
8. Close the housing and tighten the screw in the rear part of the housing (tightening torque: 1.35-1.75 Nm).

7.3 Replacing the on/off switch 13

1. Disconnect the supply cord plug from the power outlet.
2. Unscrew the screw in the rear part of the housing and remove the rear part of the housing.
3. Slacken the two screws and disconnect the two supply cord conductors.
4. Mark the positions of the flat plugs on the on/off switch.
5. Disconnect the four conductors from the on/off switch.
6. Remove the on/off switch by lifting the other tab.
7. Insert the new on/off switch.
8. Connect the four conductors to the on/off switch in accordance with the markings.
9. Slip the supply cord conductors underneath the two screws and tighten the screws (tightening torque: 0.5-0.8 Nm).
10. Close the housing and tighten the screw in the rear part of the housing (tightening torque: 1.35-1.75 Nm).

7.4 Replacing the carbon brushes 14

1. Disconnect the supply cord plug from the power outlet.
2. Unscrew the screw in the rear part of the housing and remove the rear part of the housing.
3. Use pliers to slide the spring plate to the side.
4. Remove the carbon brush with your fingers or with the aid of a suitable tool.
5. Unplug the carbon brush.
6. Plug in the new carbon brush.
7. Insert the new carbon brush into the cage.
8. Position the spring plate on the carbon brush and press the parts in firmly.
9. Replace the other carbon brush in the same way.
10. Close the housing and tighten the screw in the rear part of the housing (tightening torque: 1.35-1.75 Nm).

7.5 Checks after care and maintenance work

- After carrying out care and maintenance, check that all protective and safety devices are fitted and that they function faultlessly.

8 Transport and storage

- Do not transport electric tools with accessory tools fitted.
- Always unplug the supply cord before storing an electric tool or appliance.
- Store tools and appliances in a dry place where they cannot be accessed by children or unauthorized persons.
- Check electric tools or appliances for damage after long periods of transport or storage.

9 Troubleshooting

If the trouble you are experiencing is not listed in this table or you are unable to remedy the problem by yourself, contact **Hilti** Service.

Trouble or fault	Possible cause	Action to be taken
The tool doesn't start.	Interruption in the electric supply.	▶ Plug in another power tool or appliance and check whether it works.
	The supply cord or plug is defective.	▶ Remove the supply cord. → page 11 ▶ Fit the supply cord. → page 12
	The carbon brushes are worn.	▶ Replace the carbon brushes. → page 12
The tool doesn't work.	The tool has been overloaded.	▶ Release the on/off switch and then press it again. Then allow the power tool to run under no load for approx. 30 seconds.
The tool does not achieve full power.	The extension cord conductor cross section (gauge) is inadequate.	▶ Use an extension cord with an adequate conductor cross section.

10 Disposal

✿ Most of the materials from which **Hilti** tools and appliances are manufactured can be recycled. The materials must be correctly separated before they can be recycled. In many countries, your old tools, machines or appliances can be returned to **Hilti** for recycling. Ask **Hilti** Service or your **Hilti** representative for further information.



- ▶ Disposal of electric tools or appliances together with household waste is not permissible.

11 Manufacturer's warranty

- ▶ Please contact your local **Hilti** representative if you have questions about the warranty conditions.

1.1 על אזהות תיעוד זה

- קרא את תיאור זה במלואו לפני השימוש הראשון. רק כך ניתן להבטיח שטביחוד זה ולאלה המצוינות על המוצר.
- ציית להוראות הפעלה והאזהות שבטייעוד זה ולאלה המצוינות על המוצר.
- שמר את הוראות הפעלה תמיד במצב למו"ר, והקפד להעביר אותן לאדם שאליו אתה מעביר את המוצר.

1.2 הסבר הסימנים**1.2.1 אזהרות**

האזהרות מודיעות מפני סכנות בשימוש במוצר. במד Rin זה מופיעות מילות המפתח הבאות בשילוב עם סמלי:



סכנה! מצבת סכנה מיידית, המוביל לפציעות גוף קשות או מוות.



אזהרה! מצבת סכנה אפשרית שיכולה להוביל לפצעות גוף קשות או מוות.



דאיתות! מצבת מצב שלול להיות מסוכן ולהוביל לפצעות או לדקים לרכוש.

1.2.2 סמלים בפסקה דה

הסמלים הבאים מופיעים בתיעוד זה:



קרא את הוראות הפעלה לפני השימוש



גהניזת השימוש ומידע שימושי נוסף

1.2.3 סמלים באירועים

הסמלים הבאים משמשים באירועים:



2 מספרים אלה מפונים לאירוע המתאים בתחילת חוברת ההוראות.



3 המספרים באירועים משקפים את רצף הפעולות, והם עשויים להיות שונים מרצף הפעולות המצוינות בטקסט.



11 מספרי הפריטים מופיעים באירוע **סקירה** ותואמים את המספרים בפרק **סקירת המוצר**.



! סיכון זה נועד לעורר את תשומתך בכך המוחודה בעת השימוש במוצר.

1.3 סמלים ספציפיים לוגם המוצר**1.3.1 סמלים על המוצר**

הסמלים הבאים מופיעים על המוצר:

השתמש במגני עיניים	
--------------------	--

סיבובים לדקה	/min
--------------	------

סיבובים לדקה	RPM
--------------	-----

ס"ל"ד נקוב	ח
------------	---

קוטר	Ø
------	---

דיוג הגנה II (בידוד כפול)	<input type="checkbox"/>
---------------------------	--------------------------

1.4 פרט המוצר

המודרים של **Hilti** מיועדים למשתמש המקצועני, ורק אנשים מושרים, שעבורו הכשרה מתאימה, רשאי לתפעל, לתחזק ולתקן אותם. אנשים אלה חייבים למדוד באופן מדויק את הסכונות האפשריות. המוצר המהויר ועוצמתי שלו עלול להוות מסוכן כאשר אנשים שלא עברו הכשרה מתאימה משתמשים בהם באופן לא מקצועי או כאשר נעשה בהם שימוש שלא בהתאם ליעוד. שם הדגם והמספר הפלורי מופיעים על לוחית הוגם.

נתוני המוצר

AG 125-8SE AG 125-7SE	משחרת דזית
05	דור
	פס' סידורי

1.5 הצהרת תאימות

אנו מצהירים באחוריונו הבלעדית כי המוצר המתואר כאן תואם את התקנות והתקנים התקפיים. בסוף תייעוד זה ישנו צילום של הצהרת התאימות.
הטייעוד הטכני שורט כאן:

Hilti Entwicklungsgesellschaft mbH | Zulassung Geräte | Hiltistraße 6 | 86916 Kaufering, DE

2 בטיחות**2.1 הוואות בטיחות כלויות לכלי עבודה חשמליים**

- ▲ אזהרה קרא את כל הוואות הבטיחות וההנחיות. اي ציון להוואות הבטיחות ולהנחיות עלול להוביל להתחשנות, לשרפפה ו/או לפציעות קשות.
- שמר את כל הוואות הבטיחות וההנחיות לעין בעתיד.
- המונח "לכ' בעודה חשמל" המשמש בוואות הבטיחות מתייחס לכל' עודה חשמליים המוחברים לרשת החשמל (עם כל' חשמל) וכן לכל' עודה חשמליים המופעלים באמצעות סוללה נטענת (לא כבל חשמל).
- בטיחות במקום העבודה

 - שמר על אזור העבודה שלך נקי ודאג למתארה מספקת. חוסר סדר או תאורה לקויה במקום העבודה עלול לגרום לתאונות.
 - אין להפעיל את כל' העבודה החשמלי יוצרם בסביבה שקיימת בה סכנות פיזיות או שישנם בה נזלים, גידם או אבק דליקים.
 - כל' עבודה חשמליים יוצרם ניצוצות, שעליולים להחיטה את האבק או האדים.
 - הרחק לדים ואנשים אחרים מכל' העבודה החשמלי במהלך השימוש בו. אם דעתך תוסח אותה עלול לאבד את השילטה במכשיר.

- בטיחות בחשמל

 - תוך החשמל של כל' העבודה החשמלי חייב להתחאים לשקע החשמל. אסור לשוכות בשום אופן את תען החשמל. אל תשתמש במקרה בלבד עם כל' עבודה חשמליים הכוילים הגנת הארץ. תקעים חשמליים שלא עברו שיבוי ושקייע חשמל מתאיימים מפוחדים את הסיכון להתחשנות.
 - מגע מגע של הגוף בשחמי מוגדים כגון ציפורות, גוף חיים, תנורים ומקררים. קיימת סכנה גבואה להתחשנות כאשר הגוף שלך מוגרך.
 - הרחק כל' עבודה חשמליים מגשם או רטיבות. חזרת מים לכל' העבודה החשמלי מגדילה את הסיכון להתחשנות.
 - אל תשתמש בכבל החשמל למטרות שלא לשם הוא בוצע, ולדוגמא: אל תזוזה: אל תליקי הפעולה החשמלי והcabbel ואל תנססה לתקן את תחתך מעלה מכשינה מהcabbel. הרחק את cabbel מחום, שמן, פיניות חדות או חלקי מכשור.
 - נעים. כבלים שכיווקן או שתוכנבו בחלקים בו-זאת, השתמש רק בכבל מאריך המיעוד לשימוש בחוץ. שימוש בכבל מאריך כאשר אתה עודם עם כל' עבודה החשמלי בוצע, השתמש רק בכבל מאריך המיעוד לשימוש בחוץ.
 - אם לא ניתן להימנע משימוש בכל' העבודה החשמלי בסביבה לחאה, השתמש במפסק הגנה. השימוש במפסק הגנה מפחיתה את הסיכון להתחשנות.

- בטיחות של אבכים

 - היה נרעב, שם לב מה שאותה עושה, ופעל בתובנה כאשר אתה עובד עם כל' עבודה חשמלי. אל תפעל כל' עבודה חשמלי שסתה עירף או תחת השפעת סטם, אלכוהול או טרופות. די ברגע אחד של חסור תשומת-לב בזמן השימוש בכל' העבודה החשמלי כדי לגדלם פצעות קשות.
 - לבש תמיד ציוד מגן וושקף מגן. בלשא ציוד מגן אישן, כגון מסכת אבק, גבון מגענות החולקה, קסדה מגן או מגאי שמעה - בהתאם לסוג השימוש בכל' העבודה החשמלי - מסקינה את הסיכון לפצעות.
 - מנע הפעלה בשוגג. וזה שכל' העבודה החשמלי כבוי לפבי שאתה מחבר אותו לאספקת החשמל ו/או לפבי שאתה מחבר את הסוללה ופבי הרמות. אל ת开机 את אבכם על המתג בדמן שארת נושא את המכשיר ואל תחבר אותו לאספקת החשמל כאשר הוא מופעל, אחרת עלולות להוירם אבאות.
 - הרחק כל' כוונון או מפתחות בריגט לפני שארת מפעיל את כל' העבודה החשמלי. כל' עבודה או מפתח, הנמצא בקרבת חלקיים מסתובבים עלול לירום פצעות.
 - הימנע מתובחות גוף לא בכוכנות. עמוד באופן יציב ושמור תמיד על שוויו משקל. כך תוכל לשולט טוב יותר בכל' העבודה החשמלי במצבים לא צפויים.
 - לבש בגדים מותאמים. אל תלبس בגדים רחבים או תכשיטים. הרחק את השער, הבגדים וכפפות מחלקים בעים. בגדים רופפים, תכשיטים ושער אורך עלולים להיותם להיתפס בחלקים נאים.

כasher binut lan hatakon hakuni shaiyat abek v'leidah yis' lozada shem mohorim lochshel, yis' lahekipid lahatmash bhem bezora nacuna. Shimosh bahtkon shaiyat abek mitkutin at haconot haonavot moabek.

- שימוש וטיפול בכל העבודה החשמלי▪ אל פעיל את המכשיר בעומס יתר. השתמש בכל העבודה החשמלי המתאים לעובודה שאותה מבצע. כל העבודה החשמלי המתאים מוגטיה לך בעודה טוביה ובוטוחה יותר בתוכום הספק המקובל.
- אל משתמש בכל העבודה אם המותג שלו אינו תקין. כל עבודה חשמלי שלא ניתן עוד להפעיל או ללבוט אותו מהותה סכנה יש להקנו.
- נתק את קע החשמל מהשען ו/או סור את הטוליה לפניה שאותה מבצע כוונונים במכשיר, מחוליך כלים או לאחר שאותה מופסח לעובוד עם המכשיר. אמצעי זהירות זה מונע הפעלה בשוגג את כל העבודה החשמלי.
- שומר כל עבודה חשמליים שאינם בשימוש הרחק מושיג ים של ידיים. אל אפשר לאחסן שאינם יודעים כיצד להשתמש במכשיר או שלם קראו את ההוראות להשתמש במכשיר. כל עבודה חשמליים הם מօסנים כאשר משתמשים בהם אנסים חסרי ביסין.
- טפל בכל העבודה החשמלי בהקפודה. בדוק אם החלקים הנעים פועלם בצורה חילקה ואינם נתקעים, אם ישנים חלקים ושווים ואקוילרים המשמשים כמחשורי הפעלה והתקינה מושגים של כל העבודה החשמלי. לפניה השימוש במכשיר דאג לאתיקון חלקים תא תקין. תאנונות רבות נגרמו עקב תחזקה קלה של כל העבודה החשמליים.
- שומר על הכלים החזוקניים חדים וכקטים. כל יתר מוטפים רוטם, בעלי גורם חריגת חדים נתקעים פחות וקלים יותר לתפעול.
- השתמש בכל העבודה החשמלי, באגדירם, בכל העבודה הנוטפים וכן הלאה בהתאם לורות אליהם. התחשב לתנאי העבודה ובפעולה שעילך לבצע. שימוש בכל העבודה החשמלי למטרות אחרות מללה שולשן הוא מיעוד עול להיות מסוכן.

שירות

- דאג לתיקון כל העבודה החשמלי בלבד ורק בידי טכנאים מוסמכים, המשתמשים במקרה חילוף מקורים בלבד. כך בטיחות שמירה על בטיחות העבודה במכשיר.

2.2 הנחיות בטיחות מסווגות לעבודות החשלה, ליטוש עם ביר לייטוש, עבודה עם מרשות ברזל, הברקה וחיתוך:

- כל עבודה חשמלי זו מוגדר לשימוש כמושג, מטלשה ניר ליטוש, מרשות ברזל ומוכנת חיתוך. שום לב לכל הנחיות הבטיחות, ההוראות, האירושים והנותנים שקיבלת עם המכשיר. אם תעלם מההנחיות הבאות, התוצאה עלולה להיות התחשמלות ו/או פציעות קשות.
- מכשיר חשמלי זה אינו מתאים לעבודות הברקה. שימוש במכשיר שלא למטרה שלשמה הוא ייידר מהוה סכנה ועלול לגרום לפציעות.
- אין להשתמש באגדירים שלא אושרו והומלכו על ידי הייצרך במילוי לשימוש בכל העבודה חשמלי זה. העבודה שאפשר להבר את האבדד בכל העבודה החשמלי אינה מוגדרת השימוש בו יהי בו homo.
- מהירות הטיסוב המותרת של הכלים המחבר לחיות בוגה להובאה לפחות להישבר ולהירקך חחל. העבודה החשמלי, כל מ לחבר שמסתו כמות מה מוגדרת מוגדרת לפחות להישבר ולהירקך חחל.
- הקטור החיצוני והעובי של הכלים המחבר תחביב להתאים לנוטמים הדומים לכל העבודה שלך. אגדירים מוגדרות עלולים להיות לא מוגנים מספיק או לעובדו לאו שליטה.
- כלים בעלי חיבור עם תבריג חיביים להתאים בדיקת תלבריג שבחירת המשחזר. בכלים הדורשים התקינה באמצעות אוגן, חייב קשור הקדק של הליל להתאים לפחות, כלים שאנו מוחייבים בוגה מודקית לכל העבודה החשמלי. מיטובבו בוגה לא חילקה, יערוד חזק מאד וולדים לגרום לאבדון שליטה על כל העבודה.
- אין להשתמש בכלים קבועים. לפני של שימוש יידק השזהה בעץ בדיקה לאירועים וסודקים, שהזיה או בלוי מוגבר, בדוק מברשות ברזל לאירועים חומי בדיל משוחררים או שבורות. אם כל העבודה או האבדד מוגבר, בדוק אם הם בזיהוק או השתמש במקום זאת באגדיר שלא תיזוק. לאחר שבדקה את הכלים וחיראת אותן, ואנשי הנמצאים בקרבת מקום אל מוחן למשו התנעה של הכלים המסתובב, ואפשר למכשיר לעובוד דקה שלמה במחריות רבתה. באגדירים קבועים שברובם בוגה ברוך כל בשושן דקמת הדקה.
- לבש ציד מוגן איש. השתמש – בהחומר לטoxic העבודה – במסקי פנים צידן או במקן פנים מלא. לבש מסקת אבק, מגבי שמייע, כפפות מגן או סיר מיזוח שיגן על פניו חלקתי חומר – בהתאם לצורך. יש להגן על העיניים מפני גופים זרים שעפים בחחל, כפי שעולל להתרחש בעבודות מסוימות. מסכת אבק ומסכת הנשימה צרכיות לפחות אבק שנוצר במהלך השימוש. חשיפה ממושכת לרעש חזק עלולה לגרום בששעה.
- ואשר אנשים אחרים עומדים במרקח בטוח מאזור העבודה. כל מי שנכנס לאזור העבודה חייב לבוש ציד מגן איש. חלקים הנשברים מהחומר שבעבודה או שברים מהאבדד עלולים להעתוף בחחל ולגרום לפציעות גם מוחן לאזור העבודה הפדי.
- כאשר אתה מבעוד עבודות שבחון הכלים המחבר עלול לפגוע בקוו חשמלי מסווגים או בכלל החשמל של המכשיר אחד בכל העבודה החשמלי ורק במקרים האחריה המבודדים. מגע בקווים המוליכים דרום עלול לההיבר זרם גם לחקלים מתכתיים במכשיר שולך ולגרום להתחשמלות.
- הרחק את כל החשמל מהכלים המסתובבים. אם תאבד את השיטה במכשיר עלול כל החשמל להיהחן או להיתפס, וכך היד או הדורע שלך עלולות להיפגע מהכלים המסתובבים.
- לעומת זאת כל העבודה החשמלי לפני שהכלים המחבר נעצר. כל מסתובב עשוי להיתקל במשטח שעליו הוא מוחן, ובבקבוק דאת כל העבודה החשמלי עלול לנען לאו שליטה.
- אל אפשר לכל העבודה החשמלי לפעול אם אין מחדיק אותו. הבדיקה שולך עלולים להיתפס בכלים המסתובב, ובבקבוק דעתת הכלים עלול לחותך בגוף.

- נקה באופן סדרי את חורי האוורור של כל העבודה החסמי שlk. מפוח המנווע מושך אבק לגוף המכשיר, והצברות כמהות גודלה של אבק מתקני מהווע סכנה חשמלית.
- אין להשתמש בכלל העבודה החסמי בקרבת חומרים דלקים. ניצוצות עלולים להציג אוטם.
- אין להשתמש באביזרים הדורשים חומר קירור נחלים. שימוש בהם או בחומר קירור נחלים אחרים עלול לגרום להתחשלאות.

תען והוכיחות בטיחות מותאיימות

הרע הוא תגובה הטעינה או חסימה של כל מסתובב, כגון דיסק החזקה, דיסק ליטוש, מברשת ברזל וכן הלאה. הטעינה או חסימה מובילים לעצירה פתאומית של הכליל המסתובב. עקב קר יאץ כליל העבודה החסמי, אם איןנו נמצא בשליטה, יכולו מנוגד של כליל שנאנסם. כאשר לדיסק השחודה נתגעה או חסום בחומר שבעבודה, הקצה של הדיסק שנאנסם לחומר עשוי להיליך שם וכך גורם לפיריה לדיסק אן לרעתו, הדיסק ניע עת לעיוון המפעלי או הרחק ממנה – בהאמם לכיוון הסיבו של דיסק במקום החסימה. רגע נוצר כתזואה משימוש שאנו בכליל העבודה החסמי. ביןן למגע אותו בעדרת אמצעי הדחריות המוסברים להלן.

- החק את כליל העבודה החסמי באופן יציב והבא את גוף וזרעוני לתמונה שבה תוכל לספוג רתע. השתמש תמיד בידית או אקדיתת קומספה, אם קיימת, כדי שתהיה לך שליטה מוגנת על הרטע או מוגני התגובה בעיטת האצת המכשיר. המשמש מוביל שלוט בכוונה הרעת והtagובה אם ייקוטו אמצעי דחירות מותאיימים.
- עלולים אל תקרב את ייך לכליל מסתובב. הכליל עלול לנוע מיד שלך במקורה של רתע.
- דאג שגופך לא יימצא בתחום שלכיוונו כלפי העבודה החסמי יונע במקורה של רתע. הרעת מושך את כליל העבודה החסמי לכיוון המפוך לכיוון תנועה של דיסק במקומו החסמיים.
- היא דהרי בפיזיון בעבודה בפינות, על קצוות חדים וכן הלאה. מען מצב שבו הכליל בהדק מוחמור בעבודה או בתקע בו. בפינות, בקצוות חדים או כאשר הכליל בהדק נוטה להתקע. זה גורם לאבדן שליטה או לרעתו.
- אין להשתמש בלבל שרשרת או בלבל ניטור משונן. כלם יכולים לגרום לרעת או לאבדן השליטה בכליל העבודה החסמי.

הוכיחות בטיחות מיוחדות להשחודה וחיתוך:

השתמש אך ורק בכליל השחודה שאושור לעובודה עם כל העבודה החסמי שlk וכן ובמונט דיסק המותאים לכליל השחודה. המגן אינו יכול להגן ריבט מפבי כלפי השחודה שאיננו מיועדים לכליל העבודה החסמי שlk, ולפיכך הם אינם בטוחים. דיסקי השחודה קומרים ביציים לחיות מוקבים באופן נוכחה לכך שהשחודה מושחתה שלם לא יימצא מען לוגבה קצה מגן הדיסק. דיסק השחודה שהותקן במצבה לא נוכחה בפועל מעבר לוגבה קצה מגן די הצורך. המגן צריך להיות מוחbero בצוואה לכליל העבודה החסמי, וכייד להבטיח רמת בטיחות גבוהה עלין להיות מוכן באופן שייתיר שטח כליל גלוי מכמה שיתור קולטן בכיוון המשטחים. מנגן הדיסק עדור להגן על המסתמש מפבי שבטים, מגע בשוגג בכליל השחודה וכן מפבי ביציאות שעולמים להציג את הבגדים.

מותר להשתמש בגוף הטעינה רק לשימושם שלשםם הם מיועדים. לדוגמה: עלולם אין להשחיז באמצעות פני השטח הגדי של דיסק חיתוך. דיסקי חיתוך מיועדים להסורת חומר בעדרת קיצה הדיסק. הפעלת כוח צדי עלולה לשבור את כליל השחודה.

השתמש תמיד באוגן היידק שאינו פגום, בגודל המותאים ובגובה המתאימה לאחסנה לשבירת הדיסק. אוגנים מותאים מומוכבים בדיסק השחודה ומפחיתים את הסכנה לשבירת הדיסק. אוגנים לדיסק חיתוך שעווים להזין שונים מאוגנים של דיסקים אחרים.

אין להשתמש בדיסקי השחודה שחוקים של כל עבודה חסמיים גדולים יותר. דיסקים של כל עבודה חסמיים גדולים יותר אינם מייעדים לההירות סיבובי גבוזות של כל עבודה חסמיים קטנים יותר ועלולים להישבר.

הוכיחות בטיחות מותאיימות לחיתוך:

מען חסימה של דיסק החיתוך ואל תפעיל כוח לחיצתו. רב. אל תבעץ חתכים עמוקים מדי. עופס יתר על דיסק החיתוך מגבר את הסיכוי להתקעות או לחסימה ובכך את הסיכון לרעת או לשבירת כליל השחודה.

אל תתקרב לאזור שלפבי ומתחורי הדיסק המסתובב. במקורה של רתע כאשר דיסק החיתוך מסתובב חלק שבעובדה, כליל העבודה החסמי עלול להירק במהירות לכיוון בידיהם הדיסק. אם דיסק החיתוך נתקע או אם אתה מפעסתי לעובוד, בכבה את המכשיר והחזק אותו יציב עד שהדיסק נעצר למגמו. עלולים אל תנסה למשוך את דיסק החיתוך מהחריץ בדמן שהוא עדין מסתובב, אחרת עלול להתרחש רתע. ברר מה היא הסיבה לירוקות וופל בה.

אל תפעל מחדש את כליל העבודה החסמי כל עוד הוא נמצא מתחת החלק שהעבודה. אפשר לדיסק החיתוך להגיע למהירות הסיבוב המורבית לפני שתמשיך בଘירות בחיתוך. אחר עלול הדיסק להיתקע, להירק אל מוחן חלק או לרעתו.

לחות או חלקים גדולים יש לתמוך כדי להפחית את הסיכון לרעת עקב הטעינה דיסק החיתוך. חלקים גדולים עשויים להתכונסף תחת משקלם. יש לתמוך את החלק משבי הצדדים של הדיסק, גם בקרבת מקום החיתוך וגם בקצה החלק.

היא דהרי בפיזיון בחיתוך "כיסים" בקיות קיימים או בחלקים זווים. כאשר דיסק חודר ופוגע בcorner גז, פים או חשלם או בעוצמים אחרים הוא עלול לירום לרעתו.

הוכיחות בטיחות מותאיימת ליטוש באמצעות ניר ליטוש:

אין להשתמש בכירויות ליטוש גדולים מדי, אלא בווירות המותאיים לנוכמי המוחיבים של היצרך. נירות ליטוש הבולטים מעבר לדיסק עלולים לגרום לפצצות וכן לחסימה ולקרעיה של ניר הליטוש ולרעתו.

- הנחיות בטיחות מיוחדות לעבודה עם מברשות ברזל:
- **שים לב כי מרשות הברזל מאבדות סיבי תיל גם במקרה של שימוש רגיל.**
 - **תיל מעופפים יכולם לחדור בקלות את הגדרים ולתוך העור.**
 - **כאשר מומלץ להתקין מגן דיסק, יש לשמור מגן בין מגן הדיסק לסיבי התיל של המברשת. הקוטר של דיסקים שטוחים וקומיים עשוי להיות גדול בעקבות הפעלת לחץ והכוח המרכזי של הצלב.**

2.3 הוואות בטיחות נוספת

בטיחות של אנשים

- **השתמש במוצר רק בתנאי שהוא נמצא במצב טכני מושלם.**
- **אל תבצע בשום אופן מניפולציות או שינויים במכשיר.**
- **אין לנוע בחקלים מסתובבים – סוכנת פעעה!**
- **לבש כפפות בטיחות גם בעת החלפת תיל. מגע בכל עלה לאגרם לפציעות וכוכיות.**
- **בדוק לפחות חילת העבודה את דירוג הסוכה של האק החומר שבו תused. השתמש בשואב אבק מקצוע בעל דירוג הגנה מאושר, התואם את תקנות החוק הנכונות להגנה מאבק. אבק של חומרים דוגמת חומרים המכילים עופרת, סוג עץ מסויימים, בטון / קירות / אבני המפליקות קווץ ומינרלים כוון מוחכת עלולים להזקק לביריאות.**
- **اذג לאירוע טבו בקפוקו היבדדה, ומקרה אחר אזוזן שולש סכת שפיה מתאיימה לוגו האק שכוב ערב. גבעה בסוגי אבק אלה או שאיפתם עלולה לגרום לתיגבור אלרגיות ו/או למחלוות בכלל הכנישה של המשמש במכשיר יכלים בקרבתם פקוק. סוג אבק מסוים, כוון אבק של אלון או בוק, חשבים סטודנטים, ביחסם עשוורם חומרים אחרים המשמשים לטיפול בעץ (כוויט, חומר הגנה לעץ). רוק מוחמים לשאים לעובדו בחומרים המכילים אספסטן.**
- **ערוך הפסיקות בעבודה ותוריגלים לשיפור דרישת הזמן לאכבעות. הרעדית מהמכשיר שעשוית לאחר עבודה ממושכת לגרוע להפרעות בכלי הגוף או במערכת העצבים של האכבעות, כפות הידיים או שורייני כף היד.**

בטיחות בחשמל

- **לפני תחילת העבודה יש לבדוק אם ישם כלפי חשמל, צינורות גז או מים נסתרים. חלקים מתקטיים חיוניים במכשיר יכולים Lagerom להתחשמלות כאשר הם נגעים בשוגג בקווי חשמל.**
- **טיפול ושימור קפביים בעלי עבודה חשמלית**
- **אין להשתמש בדיסקי חיטוך ללא רוח החשזה.**
- **הדק את הכליל ואת האוגן. אם הכליל והאוגן לא הוכחו כראוי, יתכן כי לאחר כיבוי המכשיר יתנתק הכליל מהציר עקב בילמת המכונע.**
- **שים לב להנחיות היזן בנוגע לטיפול ולאחסון של דיסקי כף היד.**

3 תיאור

3.1 סקירת המוצר

①	לחוץ בעילת ציר
②	פס להנחה
③	מagnet הפעלה/כיבוי
④	גלגל לבחירת מהירות סיבוב
⑤	ידית אחיזה צדית
⑥	מפתח
⑦	אום הידוק
⑧	דיסק חיתוך / דיסק השחזה

3.2 שימוש בהתאם ליעוד

- המוצר המתואר זו משחתה דזותית חשמלית ידנית. היא מיועדת לעבודות חיתוך והשחזה של חומרים מתקטיים ומינרליים כמו גם לליטוש – ללא שימוש במים.
- מוחור להחר את המכשיר רק לרשות חשמל בעלת מתח ומדירות כמפורט לעל זהות הדגם.
- **כאשר משתמשים בשחצת הדזותית לחיתוך, חירוץ והשחזה של חומרים מינרליים חובה להשתמש במגן דיסק מתאים עם כיסוי קדמי.**
 - **כאשר עבודות בחומרים מינרליים כדוגמת בטון או אבן מומלץ להשתמש במגן שאיבה המותאם לשואב אבק של Hilti.**

3.3 מפרט אספקה

משחתה דזותית, ידית אחיזה צדית, מגן דיסק סטנדרטי, כיסוי קדמי, אום הידוק, מפתח, הוראות הפעלה.
מוצרים נוספים המאושרים עבור המוצר כולן תמצאו ב-**Hilti Store** או באינטרנט בכתובת: www.hilti.com | אורה: "ב"

3.4 כוונון מראש של מהירות הסיבוב

משחתה דזוטה זו יכולה מהירות סיבוב קבועות מראש לבחירה:

- AG 125 7SE: 6000 סל"ד – 11500
- AG 125 8SE: 3500 – 11500 סל"ד

3.5 חסימת הפעלה חדשה

אם החשמל למכשיר מתנתק בדופן שטחת הפעלה/כיבוי בעל, המכשיר לא יתחל לפעול מחדש באופן עצמאי לאחר חידוש אספקת החשמל. ראשית יש לשחרר את מתג הפעלה/כיבוי ואז להחזיר עליו מחדש.

3.6Cisco קודמי עבור מגן הדיסק 2

לצורך השזהה באמצעות דיסק חיתוך באמצעות דיסק חיתוך בעבודה בחומרים מתכתיים יש להשתמש במגן דיסק סטנדרטי הכלולCisco קודמי.

3.7 מגן שאיבת אבק (השזהה) DG-EX 115/4,5" (אבטיר) 3

מערכת ההשזהה מօדעת לליטוש מודם של חומרים פינריים באמצעות דיסק יהלום קעורים. דירות אסורה לעבך מתחכמת עם מגן דיסק זה.

3.8 מגן שאיבת אבק (חיתוך) C DC-EX 125/5" (אבטיר) 4

בעבודות חיתוך בקריות ובכטוטן יש להשתמש במגן שאיבת האבק (חיתוך) C DC-EX 125/5". דירות אסורה לעבך מתחכמת עם מגן דיסק זה.

4 חומרים מוחלמים

מוגן להשתמש רק בדיסק פיבר מחזוקם עם חוגר מקשר שרכף סינטטי 125 ס"מ, שאושרו לעבודות במהירות סיבוב של לפחות 11500 סל"ד ובמהירות הקיף של 80 מ"ש/ט'.

עובי דיסק ההשזהה המקסימלי המותר הוא 6.4 מ"מ ועובי דיסק החיתוך המקסימלי המותר הוא 2.5 מ"מ.

שים לב! בעבודות חיתוך וחירוץ עם דיסק חיתוך יש להשתמש תמיד גם במגן הדיסק הסטנדרטי עם Cisco קודמי.

דיסקים

חומר לעיבוד	קוד	שימוש	דיסק השזהה-חיתוך
מתכתי	AC-D	חיתוך, חירוץ	דיסק חיתוך יהלום
פיבר	,SPX) DC-D ,DC-TP (P ,SP	חיתוך, חירוץ	דיסק השזהה ליטוש
מתכתי	AN-D ,AF-D ,AG-D (P ,SP ,SPX) DG-CW	השזהה	דיסק השזהה יהלום
פיבר	MBRSHFT PLDHA	مبرשות פלדה	דיסק השזהה יהלום
מתכתי	AP-D	השזהה	דיסק פיבר

התאמת הדיסקים לסוג העבודה

פריט	ציוד	dg-cw	AC-D	AG-D AF-D AN-D	DG-CW (P ,SP ,SPX)	DC-TP DC-D ,SP ,SPX) (P	AP-D
א	מגן דיסק		X	X	X		X
ב	Cisco קודמי (בשילוב עם א')		—	—	—	X	—
ג	מגן שאיבת אבק (השזהה) הו דיסק EX 115/4.5" או DG-CW 115		—	—	X	—	—
ד	מגן שאיבת אבק (חיתוך) הו DC-EX 125/5" (C) (בשילוב עם א')		—	—	—	X	—
ה	דיאת איזיה צדית		X	X	X	X	X
ו	אום היוזק		—	X	X	X	—
ז	אונג נגדי		—	X	X	X	—
ח	אום היוזק עבור דיסק פיבר		X	—	—	—	—

4CS ,3CS 4SS ,3SS	AP-D	DC-TP DC-D ,SP ,SPX) (P	DG-CW ,SP ,SPX) (P	AG-D ,AF-D AN-D	AC-D		פriet	ציוויל
—	X	—	—	—	—	—	ט	אלהת

5 נתוני טכניים

5.1 משחזר דזית

הערה

את המותח בנקוב, הדום הנקוב, התדיות וההטפק הנקוב נמצא בלוחית הדגם הספציפית למדינתך.

בעת הפעלה באמצעות גברטו או שכאי הספק המוצא שלהם חייב להיות לפחות כפול מהספק הנקוב הנוכחי על מנת הדגם שאל מכשיר. מתח העבודה של השcai או הגנרטור חייב להיות תמיד גבוה שבין +5% ל-15% - בהתאם למתח הנקוב של המכשיר.

AG 125-8SE	AG 125-7SE	
אט 800 ואט	710 ואט	הספק בנקוב
סל"ד בנקוב 11,500 סל"ד	11,500 סל"ד	סלאט בנקוב
קוטר דיסק מרבי 125 מ"מ	125 מ"מ	קוטר תבריר
M14	M14	אורך תבריר
מ"מ 22	מ"מ 22	משקל בהתאם לתהיליך 01 EPTA
2.0 ק"ג	2.0 ק"ג	

5.2 EN 60745

ערכי לחץ הקול והרעידות המציגים בהוראות אלה מודדו בהתאם למודdale התקני, וכןן להשתמש בהם לצורך השוואה בין כל עבודה שלםליים. הם מותאים גם להערכת דמיון של העומסים. הנציגים המציגים תקפים לשימושים העיקריים בכל העבודה החשמלי. אליהם אינם משתמשים בכל העבודה החשמלי לשימושים אחרים, בשילוב בבדים אחרים או אם המכשיר אינו עבר תחזוקה מספקת, הנציגים עשויים להשתנות. בעקבות זאת פירש העומסים למשך זמן העבודה כלו עשויה להיות גבוהה באופן משמעותי. לצורך הערכה מודעית של העומסים יש לחתוך בחשבו גם את הדימיניבים שבהם המכשיר כבוי או שביהם הוא פועל אך אינם בשימוש פעול, בעקבות זאת פירש העומסים נוספיםות להגנה על המשמש מיפוי ההשעות של קליל ו/או רעדות, כגון: תחזוקה של כל העבודה החשמלי ושל כל העבודה המוחברים, שמירה על ידיים חמות, ארגון תהיליך העבודה.

ערכי רעש

AG 125-8SE	AG 125-7SE	
96.3 dB(A)	96.3 dB(A)	רמת הספק קול (L_{WA})
3 dB(A)	3 dB(A)	אי-זוזאות ברמת הספק הקול (K_{WA})
85.3 dB(A)	85.3 dB(A)	רמת לחץ קול (L_pA)
3 dB(A)	3 dB(A)	אי-זוזאות רמת לחץ קול (K_{pA})

ערכי רuidות כולל

AG 125-8SE	AG 125-7SE	
2.8 מ"ש ² /שנ ²	4.8 מ"ש ² /שנ ²	השחתת פci שטח עם ידיות מפחיתה רuidות ($a_{h,AG}$)
3.6 מ"ש ² /שנ ²	3.6 מ"ש ² /שנ ²	לטוש באמצעות ניר ליטוש ($a_{h,DS}$)
1.5 מ"ש ² /שנ ²	1.5 מ"ש ² /שנ ²	אי-זוזאות (K)

6 פעולה

6.1 הכנה לעבודה

היררכיה

סכת פציעה! תחילת תנועה לא מכונה של המוצר.



נתק את תקע החשמל לפני שאתה מבצע כוונונים במכשיר או מחליף אביזרים.

ציית להוראות הבטיחות והאזהרות שבתיעוד זה ולאלה המצוינות על המוצר.

6.2 התקנת דיט האחיזה האძת

הברג את ייית האחיזה הצידית לאחד מהתבוריים המזועדים לכך.

6.3 מגן דיסק

שים לב להוראות ההתקנה של מגן הדיסק.

6.3.1 התקנת מגן הדיסק 5

הערה

הקידוד על מגן הדיסק מודוא שביתן יהיה להתקין רק מגן דיסק המתאים למכשיר. מלבד זאת מונע פס הקידוד בפייה של מגן הדיסק על הכליל.

- 1.فتح את ידיית ההידוק.
- 2.חבר את פון הידוק עם פס הקידוד אל חרץ הקידוד בצדואר המשוחזר.
- 3.סובב את מגן הדיסק למיקום הדורש.
- 4.סגור את ידיית ההידוק כדי לקבע את מגן הדיסק.

הערה

מגן הדיסק כבר מכונן לקלוטור המתאים בעדרת בורג הכוונון. אם הפונה חלש מדי כאשר מגן הדיסק מחובר, ניתן להדק מעט את בורג הכוונון כדי לחזק את כוח המתיחה.

6.3.2 כוכון מגן הדיסק 6

- 1.פתח את ידיית ההידוק.
- 2.סובב את מגן הדיסק למיקום הדורש.
- 3.סגור את ידיית ההידוק כדי לקבע את מגן הדיסק.

6.3.3 הסרת מגן הדיסק

- 1.פתח את ידיית ההידוק.
- 2.סובב את מגן הדיסק עד שפס הקידוד תואם את חרץ הקידוד ואד הסר אוטו.

6.4 התקנה או הסרה של הכיסוי הקדמי 7

- 1.חבר את המגן הקדמי על מגן הדיסק הסטנדרטי עד שהוא נגען.
- 2.כדי להסייע אותו יש לפתוח את הנעללה של המגן הקדמי ולהסיר אותו ממאן הדיסק הסטנדרטי.

6.5 התקנה או הסרה של דיסקים

דירות

סכתת ציפוי. הכליל עלול להיות חם מאוד.

لبש כפפות מגן בעת החלפת כליל.

הערה

יש להחליף דיסקי יהלום ברגע שהספק החיתוך/הלייטוש פוחת באופן ניכר. בדרך כלל זה מתרחש כאשר גובה סגמנטני הילולים נמוך מ-2 מ"מ (" $\frac{1}{16}$ ").

סוג דיסק אחרים יישלחחלף ברגע שהספק החיתוך פוחת באופן ניכר או אם במהלך העבודה נוצר מגע בין חלקים של סחהחת החווית (בלבד הדיסק) לבין החומר שבכובוזה.

דיסק זה השחזה יש להחליף כשמגיע תאריך התגובה שלהם.

6.5.1 התקנת דיסק השחזה 8

- 1.נתק את קלק החשמל משען רשת החשמל.
- 2.ואו טבעת-O נמצאת באוגן הנגדית והשייא תקינה לגמורי.

תוצאה

טבעת O איננה תקינה.

אין טבעת O באוגן הנגדית.

חבר אוגן נגדי חדש עם טבעת O.

עברית

21

3. חבר את האגן הנקדי לציר המכשיר.
4. הרכב את דיסק ההשזה.
5. הביר את אום ההידוק בהתאם לכל שימוש.
6. לחץ על לחץ נעילת הציר והחזק אותו לחוץ.
7. הדק את אום ההידוק בעדרת המפתח ולאחר מכן שחרר את לחץ נעילת הציר והסר את המפתח.

6.5.2 הסרת דיסק השזה

1. נתק את תקע החשמל משקע רשת החשמל.

דזרות

- סכתם שבירה והרט.** לחיצה על לחץ נעילת הציר בדיקן שהציר מסתובב עלולה לגרום לשחרור הכליל המחבר. ▶ לחץ על לחץ נעילת הציר רק כאשר הציר אינו מסתובב.

2. לחץ על לחץ נעילת הציר והחזק אותו לחוץ.
3. חבר את מפתח האוטומס וסובב אותו נגד כיוון השעון כדי לשחרר את אום ההידוק המהרי.
4. שחרר את לחץ נעילת הציר והוציא את דיסק ההשזה.

6.6 התקנת מברשת פלדה

1. נתק את תקע החשמל משקע רשת החשמל.
2. חבר את ידיית האחיזה הצידית. ← עמוד 21
3. התקין את מגן הדיסק. ← עמוד 21
4. חבר את מברשת הפלדה ובברgere ידנית.
5. לחץ על לחץ נעילת הציר והחזק אותו לחוץ.
6. הדק את מברשת הפלדה באמצעות מפתח בריגים מתאים.
7. לאחר מכן שחרר את לחץ נעילת הציר והסר את מפתח הבריגים.

6.7 התקנת דיסק פיבר

1. נתק את תקע החשמל משקע רשת החשמל.
2. חבר את ידיית האחיזה וצדית. ← עמוד 21
3. התקין את מגן הדיסק. ← עמוד 21
4. חבר את אצלהות ואת דיסק הפיבר והברג והדק את אום הרידוק.
5. לחץ על לחץ נעילת הציר והחזק אותו לחוץ.
6. הדק את אום ההידוק בעדרת המפתח ולאחר מכן שחרר את לחץ נעילת הציר והסר את המפתח.

6.8 עבודה

אדירה

- סכתה עקב כל פגום!** אם כבל החשמל או הcabל המאריך נזקוק במהלך העבודה, נתק את מיד את המכשיר עם הקבל מרשת החשמל. אל תיגע במקרה!
- בדק באופן סדרי את כל הcabלים. החלף כבל מאריך לא תקין. אם כבל החשמל פגום, פנה לחשמלאי מוסמך לצורך החלפתו.

כלל מומלץ להשתמש במפסק הגנה (RCD) בעל זרם התורה של 30mA.

6.9 הפעלה

1. לחבר את תקע החשמל לשקע רשת החשמל.
 2. לחץ על החלק האורי של מותג הפעלה/כיבוי.
 3. דחף את מותג הפעלה/כיבוי קדימה.
 4. נעל את מותג הפעלה/כיבוי.
- ▶ המנגע פעול.

6.10 חיתוך

- בעת החיתוך הפעיל כוח דחיפה מותן ועובד בצורה ישרה עם כלי העבודה (זווית העבודה כ- 90° לפני השטח של החומר שאתה חותם).

הערה

- הדרך הטובה ביותר לחותן פרופילים וצינורות מרובעים קטנים היא לעובד במקום בעל הקוטר הקטן ביותר.

זהירות



סכנת פציעה. דיסק החיתוך עלול להתפוצץ, כך שחלקים ממנו יתעופפו ויגרמו לפציעות.

◀ לעלם אין להשתמש בדיסקי חיתוך לצורך עבוזות השודה.

▶ חד את המכשיר מצד גבורה גשא של 5° עד 30° תוך פעולה לחץ מתון.

▶ החלק שבឧודה לא יתחמס מוד', לא ישנה את צבעו ולא ייווצרו חירוצים.

6.12 כיבוי

◀ לחץ על החלק האחורי של מתג הפעלה/כיבוי.

▶ מתג הפעלה/כיבוי קופץ למקומו כיבוי והמנע כבה.

7 טיפול ותחזוקה

7.1 טיפול ותחזוקה

זהירה



סכנת התחשמלות! בעבודות טיפול ותחזקה כאשר תקע החשמל מחובר לשקע עלולות להוביל לפציעות ולכויות קשות.

◀ לפני ביצוע עבודות טיפול או תחזקה כלשהי יש להקפיד ולנטק את תקע החשמל!

טיפול

- הסר בזרירות לכlok שנדרך.
- נקה בזרירות את חירכי האוורור באמצעות מרשתת יבשה.
- נקה את גוף המכשיר ורק בעדרת מטלית להה מעט. אין להשתמש בחומר טיפול המכילים סיליקון, מאחר שהם עלולים לגרום לחלי הפלסטי.

תחזקה

- יש לבדוק באופן סדרי את כל החלקים הגלויים כדי לאთ בדקם ולזוזו כל הרוכבים פועלם באופן תקין.
- אם ישם נזקים או תקלות אין להפעיל את המכשיר החשמלי. הבא מיד את המכשיר לתיקון במ官方微博 של **Hilti**.
- לאחר עבודות טיפול ותחזקה יש להקפיד ולהנתק את כל התקני ההגנה ובזקק את תפקוד המכשיר.

עזרה

לזרוך הפעלה בטוחה של המכשיר יש להשתמש רק בחלקי חילוף וחומרים מוחכמים מקוריים. את חלקי החילוף, החומרם www.hilti.group / www.hilti.com

7.2 הצלפת כבל חשמל

7.2.1 פיקוק כבל החשמל

1. נתקק את תקע החשמל משקע רשת החשמל.

2. שחרור את הבורג בחלק האחורית של גוף המכשיר והסר את החלק.

3. שחרור את שבי הרגלים של מזוקן הכבול.

4. שחרור את שני הרגלים וושקח החוצה את כבל החשמל.

7.2.2 התקנת כבל החשמל

1. השחל את כבל החשמל דרך החלק האחורי של גוף המכשיר.

2. הכנס את כבל החשמל דרך השרוול.

3. הסר 5 mm ביזוד בקצה גידי הכבול.

4. חחף את גידי הכבול דרך מזוקן הכבול.

5. הכנס את גידי הכבול מותחן לשני הרגלים והדק את הרגלים (מומנט היוזק: $0.8\text{--}0.5\text{ N}\cdot\text{m}$).

6. מקם את כבל החשמל כך שהשרול יימוק ללא זווית.

7. וזה כי מעטפת הכבול בולטות 5 mm מהדק הכבול, והדק את הרגלים של מהדק הכבול (מומנט היוזק: $1.75\text{--}1.35\text{ N}\cdot\text{m}$).8. סגור את הגוף והדק את הבורג בחלק האחורית של גוף המכשיר (מומנט היוזק: $1.75\text{--}1.35\text{ N}\cdot\text{m}$).

7.3 הצלפת מתג הפעלה/כיבוי

1. נתקק את תקע החשמל משקע רשת החשמל.

עברית

23

2. שחרר את הבורג בחלק האחורי של גוף המכשיר והסր את החלק.
3. שחרר את שני הרגלים ונטק את שני הגידים של התקע.
4. ספן את המיקום של נעליו הכלב מהתה הפעלה/כיבוי.
5. נתק את אברעתת הכלבים ממתג הפעלה/כיבוי.
6. פרק את מתג הפעלה/כיבוי על ידי הרמת הלשונית האחורה.
7. חבר מותג הפעלה/כיבוי חדש.
8. חבר את אברעתת הכלבים למתג הפעלה/כיבוי בהתאם לסימון.
9. הכנס את גידי הכלב מתחת לשבי הרגלים והדק את הרגלים (מומנטן היודק: 0.8–0.5 נ"מ).
10. סגור את הגוף ודקק את הבורג בחלק האחורי של גוף המכשיר (מומנטן היודק: 1.75–1.35 נ"מ).

7.4 חילפה מרשות פחם

1. נתק את התקע החשמל משקע רשת החשמל.
2. שחרר את הבורג בחלק האחורי של גוף המכשיר והסר את החלק.
3. באמצעות פלייר דף את הלוחית הקפיצית הצהה.
4. הוציאת מברשת הפחים ידנית או באמצעות כל בעודה כלשהו.
5. נתק את התקע של מברשת הפחים.
6. חבר את התקע של מברשת הפחים החדש.
7. הכנס את מברשת הפחים החדש לכלווב.
8. הנח את הלוחית הקפיצית על מברשת הפחים והדק אותה.
9. החלף את מרשות הפחים האחורית באחוריו אוון.
10. סגור את הגוף ודקק את הבורג בחלק האחורי של גוף המכשיר (מומנטן היודק: 1.75–1.35 נ"מ).

7.5 בדיקות לאחר עדות טיפול ותחזקה

◀ לאחר עדות טיפול ותחזקה יש לבדוק שכל התקני ההגנה מותקנים ופועלים ללא תקלות.

8 גובלה ואחסון

- אין להוביל את המכשיר החשמלי כאשר מחובר אליו כל'.
- יש להקפיד לנתק את תקע החשמל לפני אחסון המכשיר.
- יש לשורר את המכשיר במקום שיש הרוק סחיג ידים של ילדים ואנשים לא מורשים.
- לאחר הגובלה או אחסון ממושך יש לבדוק את המכשיר החשמלי לפני שימושים בו שוב, כדי לאטור בדקים.

9 תיקון תקלות

אם מתרחשת תקלה שאינה מסבירה בטבלה זו או שאין יכול לתקן בעצמך, פנה לשירות של **Hilti**.

תקלה	סיבה אפשרית	פתרון
המכשיר אינו מוחיל לפועל.	איספקת החשמל נזוקה.	▪ חבר מכשיר חשמלי אחר ובודק אם הוא פועל.
המכשיר אינו מוחיל לפועל.	כבל החשמל או תקע החשמל אינם תקינים.	▪ פרק את כבל החשמל. ← עמוד 23 ▪ התיקן את כבל החשמל. ← עמוד 23
המכשיר אינו מוחיל לפועל.	הפחמים נשחקו.	▪ החליף את מברשת הפחים. ← עמוד 24
המכשיר אינו מוחיל לפועל.	עומס יתר של המכשיר.	▪ שחרר את מתג הפעלה/כיבוי ולהזע עליון מחדש. עצת אפשר למכשיר לפעול כ-30 שניות בסיל"ד סורק.
המכשיר אינו מוחיל לפועל בעוצמה מלאה.	קוטר הכלב המאריך קטן מדי.	▪ השתמש בכבל מאריך עבה מספיק.

10 סילוק

⊗ המוצרים של **Hilti** מיוצרים בחלקים הדגולים חמורים ינקיים לפחות. כדי שנីוין יהיה למסדרה הפרדת חמורים מקצועי. במידיניות ובוותת **Hilti** קיבל את המכשיר היישן שלך בחזרה לצורך מיזוז. פנה לשירות של **Hilti** או למשווק.

אין להשליך כל' עבודה חשמלית לפסולת הביתי!



◀ אם יש לך שאלות בנוגע תכאי האחוריות, פנה למשווק **Hilti** הקרוב אליך.



Hilti Aktiengesellschaft
Feldkircherstraße 100
9494 Schaan | Liechtenstein

AG 125-7SE (05)

[2017]

AG 125-8SE (05)

[2017]

2006/42/EG

EN ISO 12100

2011/65/EU

EN 60745-1

2014/30/EU

EN 60745-2-3

Schaan, 08/2017

A handwritten signature in black ink that reads "paolo luccini".

Paolo Luccini

Head of BA Quality and
Process-Management

BA Electric Tools & Accessories

A handwritten signature in black ink that reads "Tassilo Deinzer".

Tassilo Deinzer

Executive Vice President

BU Electric Tools & Accessories



Hilti Corporation

LI-9494 Schaan

Tel.: +423/234 21 11

Fax: +423/234 29 65

www.hilti.group

Hilti = registered trademark of Hilti Corp., Schaan



2177169

Pos. 1 | 20170908